

Log # 5

Aircraft Record General Information

Manufacturer Cessna Model 172M

Serial 17262836 Registration Number _____

Date of Manufacture _____

Engine(s) currently installed:

Manufacturer Lycoming Model 0-320-E2D Serial L-31402-27A

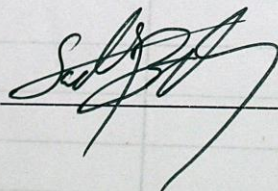
Manufacturer _____ Model _____ Serial _____

YEAR	TOTAL TIME IN SERVICE
20 22	
DATE	

Current Weight and Balance Information		
Empty Weight	Useful Load	Remarks
June 3, 2022	Cessna 172M	N 13543
SN# 17262836	Hobbs: 791.8	Tach: 3448.6

Calvin Taft Electronics Inc. (405) 789-1268
 R.S. IN2R914K Hanger #3C Wiley Post Airport
 Bethany, Oklahoma 73008
 Transponder Mfg. By Boeing Model no. KT-116
 S/N 7123 has been tested, inspected and found to
 comply with FAR 91.413 Reference WO# 15614
 by Kerry A. Christian Date 13th 2022

Removed pilot side outboard and inboard seat tracks.
 Installed new McFarlane FAA/PMA pilot outboard seat rail PN/ MC0511243-2 Lot# 49690
 Installed new McFarlane FAA/PMA pilot inboard seat rail PN/ MC0511243-4 Lot# 51708
 Installation eligibility is per FAA/PMA No. PQ3732CE
 All work above meets AC 43.13 1B and Cessna 100 Series Maintenance Manual. With work
 stated above only, aircraft is returned to service.

Scotty Butler  A&P 3021434

YEAR
20 **22**
DATE

TYPE: CESSNA 172M	REG: N13543	SN: 17262836
HOBBS: 791.8	TTAF: 7628.0	TAC: 3448.6
DATE: 4 JUNE 2022		

Removed all access panels and lube aircraft. Inspected and cleaned fuel system strainers. Inspected brakes, linings and service brake reservoirs. Cleaned and gapped spark plugs. Replaced air box filter element PN: BA-6108. Replaced cargo door handle return spring PN: S1359-7. Repaired carburetor airbox assembly, reference Associated Aero Services, Inc. W.O. 24310. Pilot seat tracks replaced reference previous log entry dated 3 June 2022. Performed ELT operational check IAW FAR 91.207(d). ELT Batteries expire: **MAR 2023**. Checked AD's and C/W recurrent AD's 2011-10-09, 87-20-03, 76-07-12 and 90-06-03R1.

I certify that this airframe has been inspected in accordance with an Annual Inspection in accordance with FAR Part 43, Appendix D and was determined to be in airworthy condition.

Ernest M. Garcia
ERNESTO M. GARCIA
IA002845378

Tach					
9-29-22	3465.5	Installed	New Battery	Concorde	RG-25XC, SN 41248999
		<i>Owner</i>	<i>Similar</i>	<i>Owner</i>	PP2024997
6-11-22	3448.6	Replaced seat rollers on both seats with McFarlane Seat - KT-1 Seat Kits		<i>Owner</i>	PP2024997

YEAR 20 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
12-2-22	3468.7		7648.1	installed uAvionix tail Beacon T50 PN UAV-1002183-101 S/N 2020950, SS10: Beacon-1127 password: SpoilerHeading See 337 form this date. <i>John D. Morin</i> A4P, IA 3335839 Calvin Taff Electronics Inc. (405) 789-1268 R.S.IX2R914K Hanger #3C Wiley Post Airport Bethany, Oklahoma 73008 Transponder Mfg. By <i>King</i> Model no. <i>KT 76</i> S/N <i>7283</i> has been tested, inspected and found to comply with Part 43 Appx F Reference WO# <i>15502</i> by <i>Amy K. Christie</i> Date <i>29 Dec 2022</i>